



# VeriMark IT Windows 11 Manual Driver Install

## Install the driver through Windows 11 Manual driver install


1. On the VeriMark support page, select **VeriMark** to go to the setup guides and driver download.

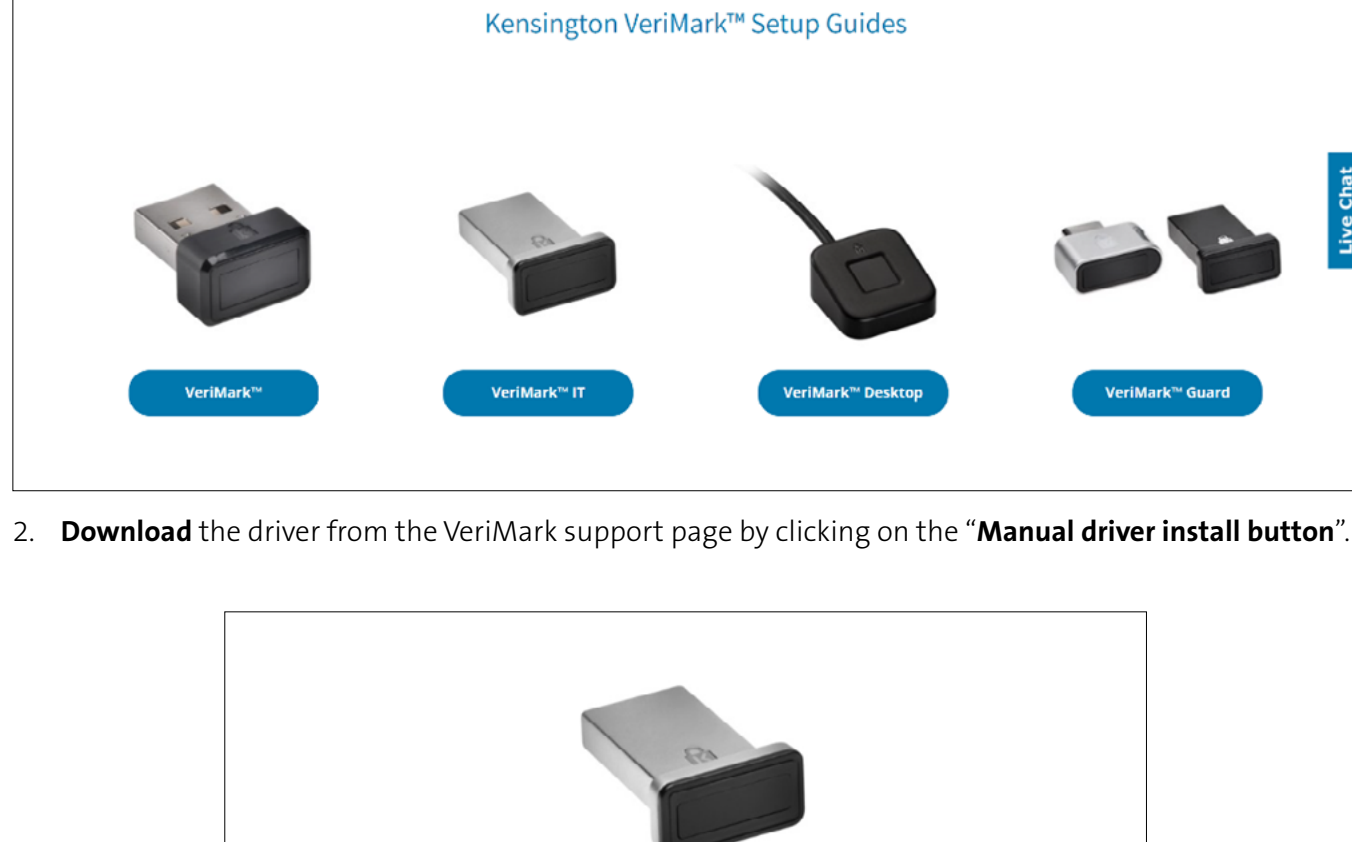


2. **Download** the driver from the VeriMark support page by clicking on the “Manual driver install button”.

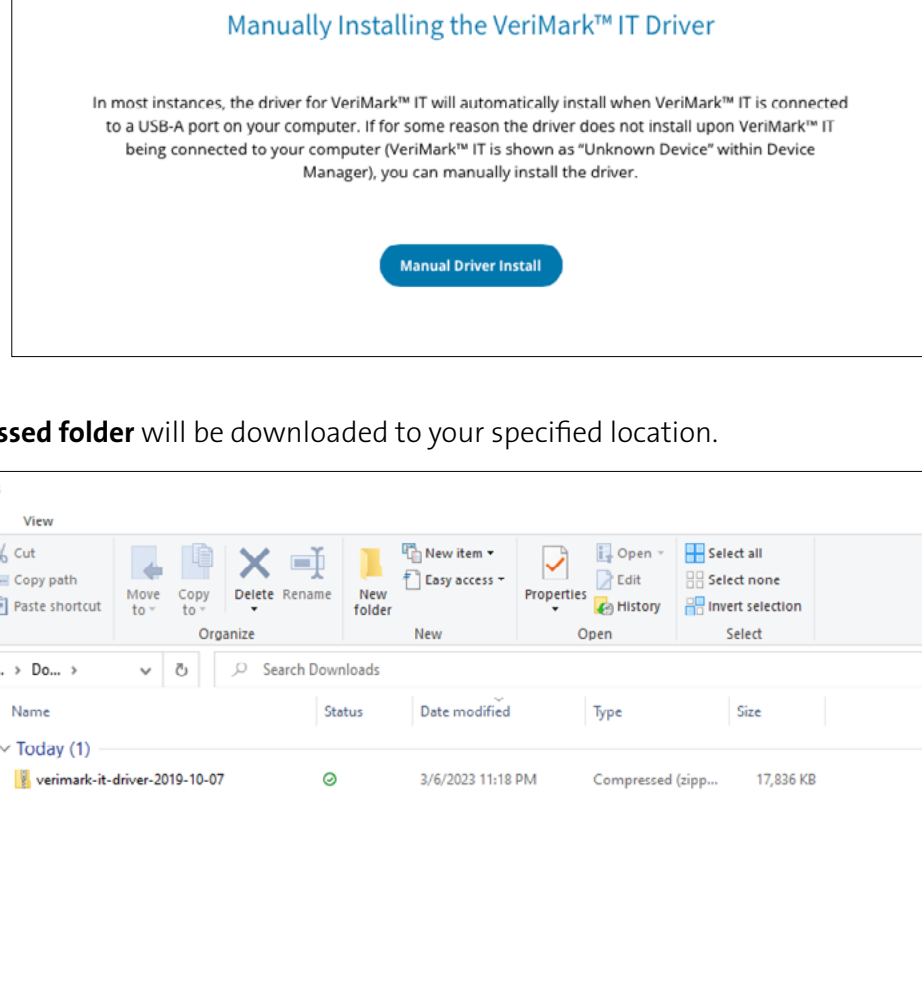


3. The **compressed folder** will be downloaded to your specified location.

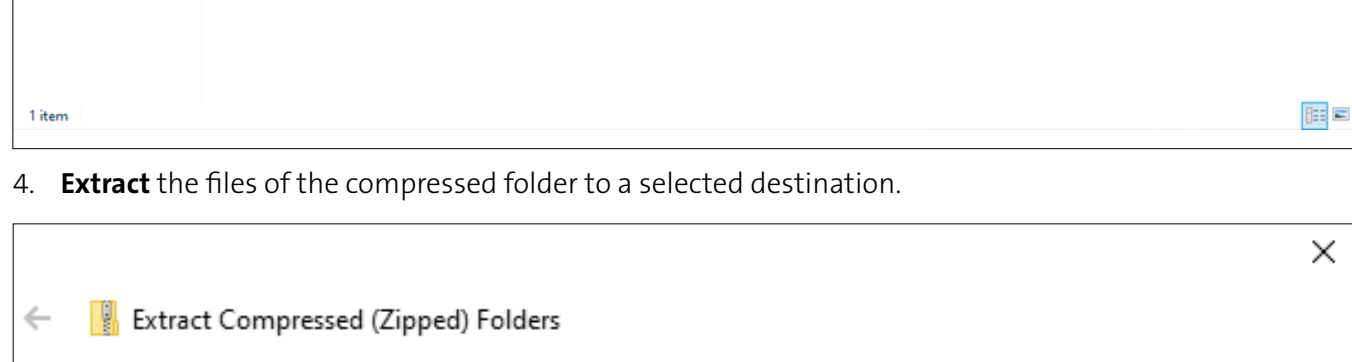


4. **Extract** the files of the compressed folder to a selected destination.

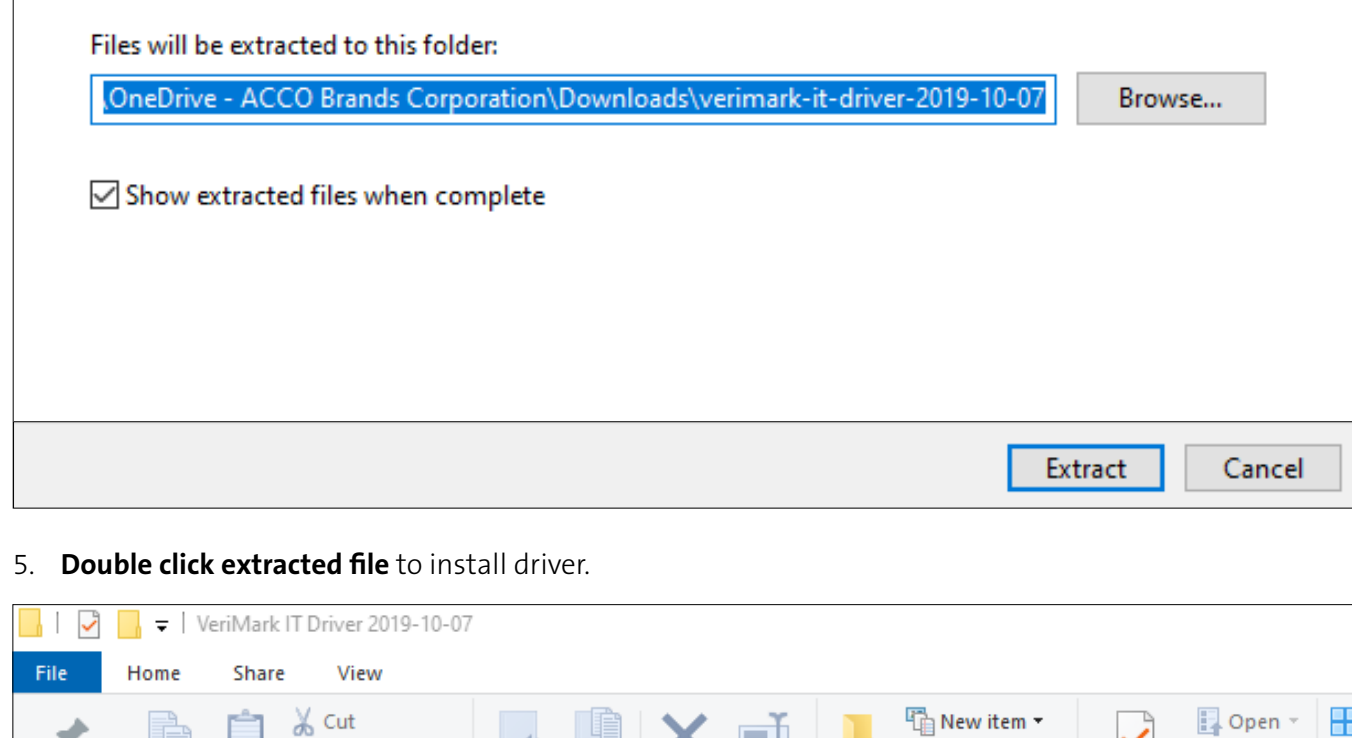

5. **Double click** extracted file to install driver.

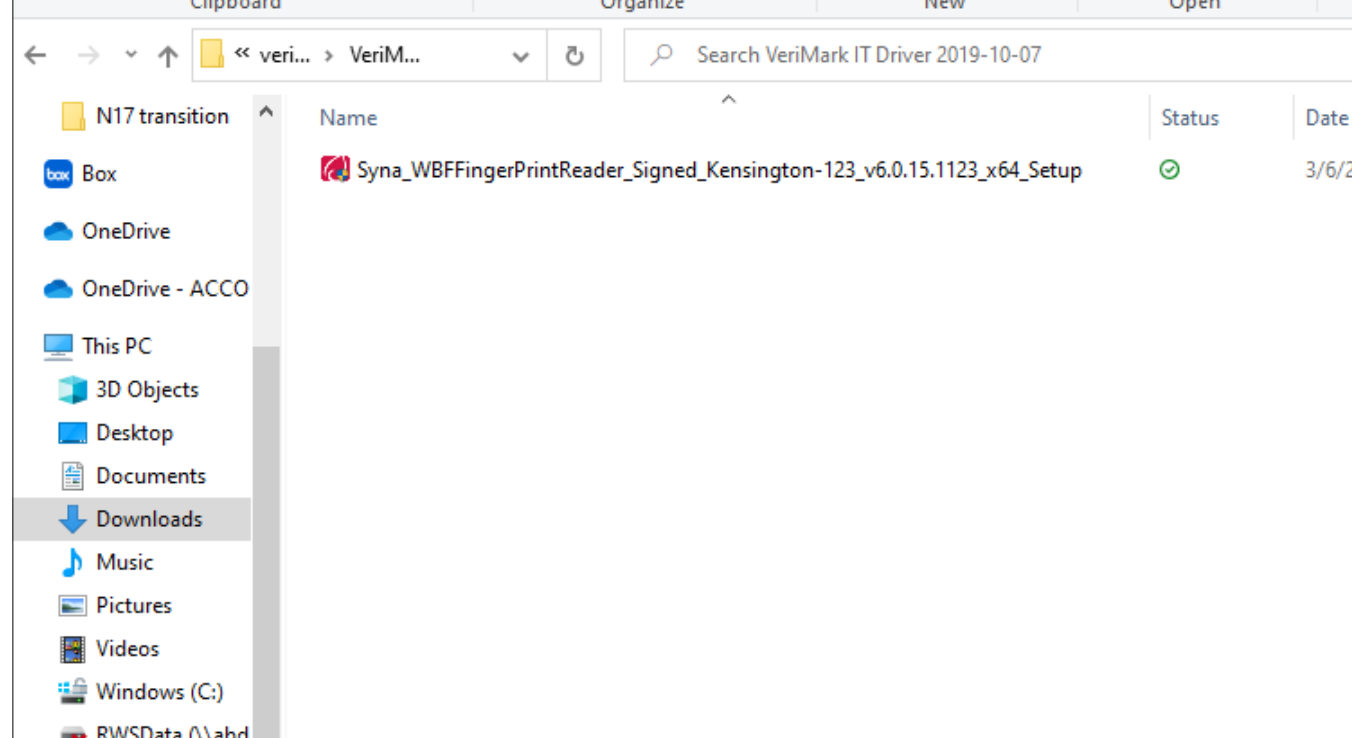


6. Kensington fingerprint key will show on device manager.

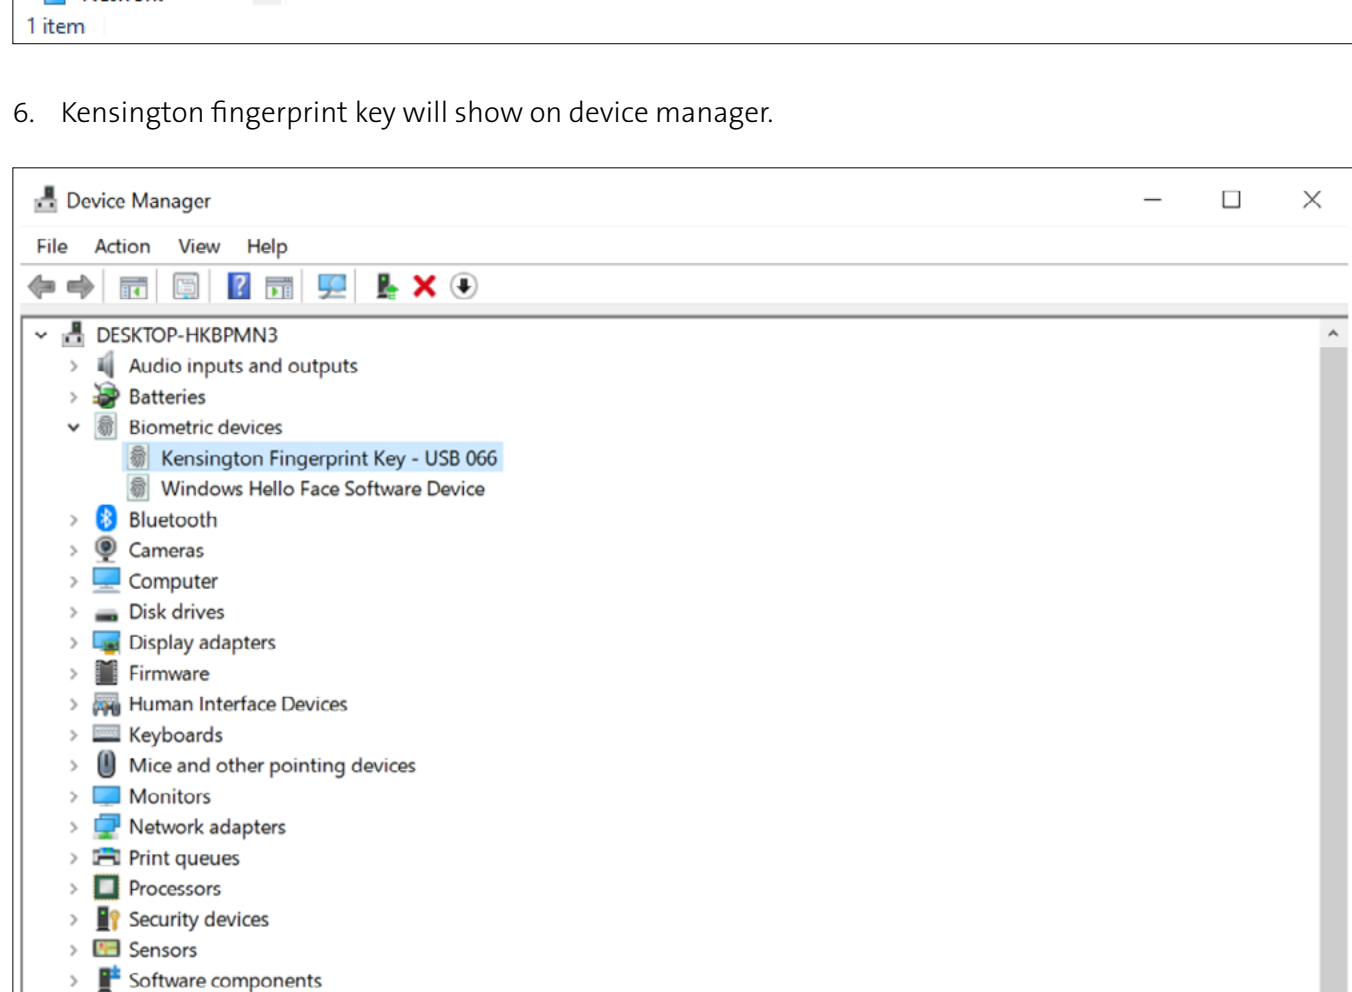


## VeriMark™ Windows 11 (Windows Hello) Setup Guide


1. Click on **Start** on the taskbar and **click on Settings**.

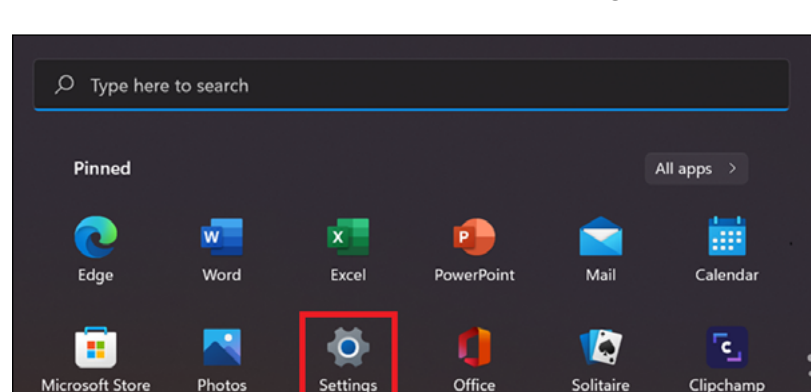


2. Click on **Accounts** to show sign in options.

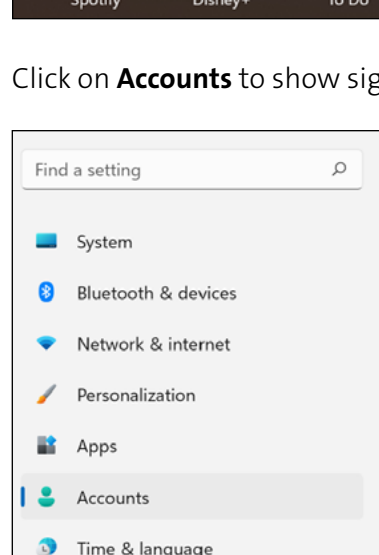


3. Click on **Sign-in** options.

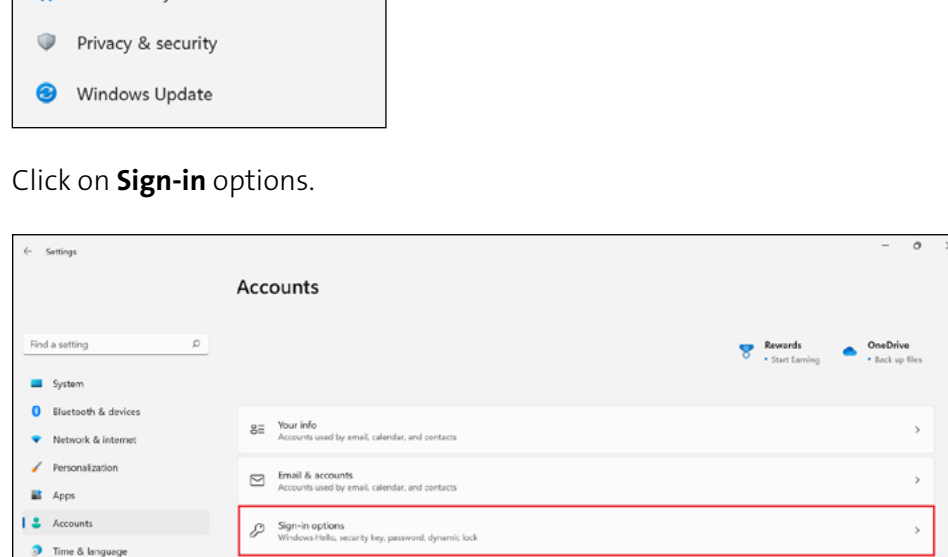


4. Alternatively, you can **click on the magnifier glass** on the taskbar and **search for “Windows Hello”**.

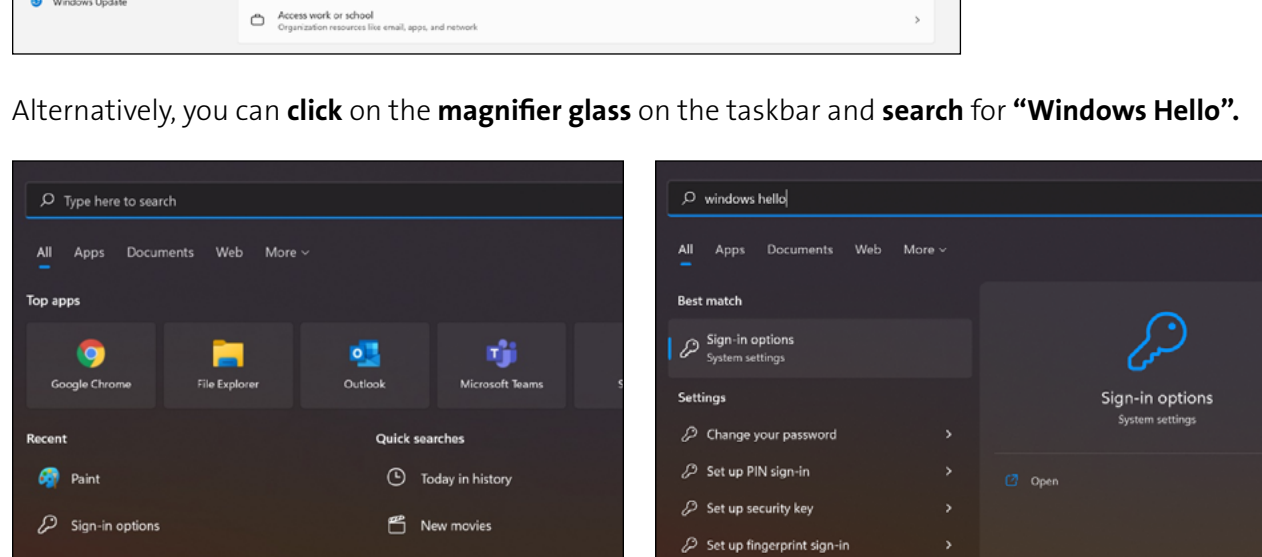


5. Click on **Fingerprint recognition (Windows Hello)** and **Set up**.

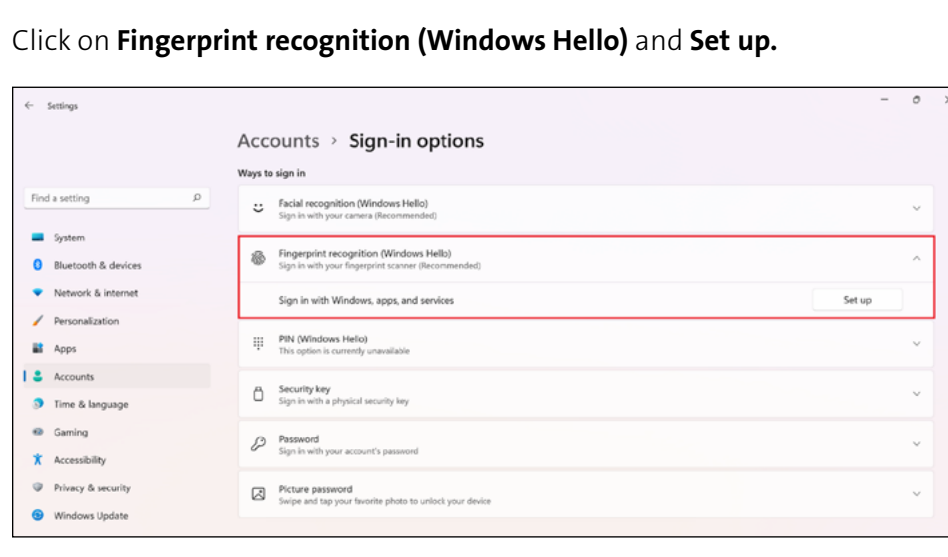


6. On the next window **click on Get Started**.

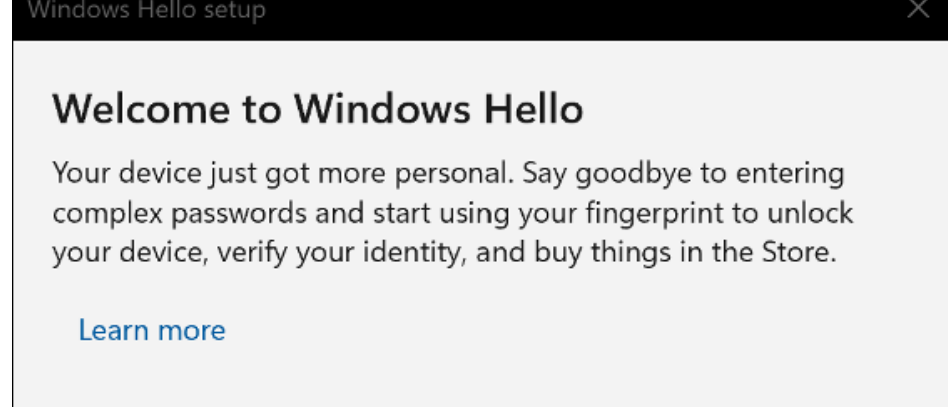


7. If it is the first time using Windows Hello, you need to **add a security PIN**. Enter a security key PIN then click **OK** for next step.

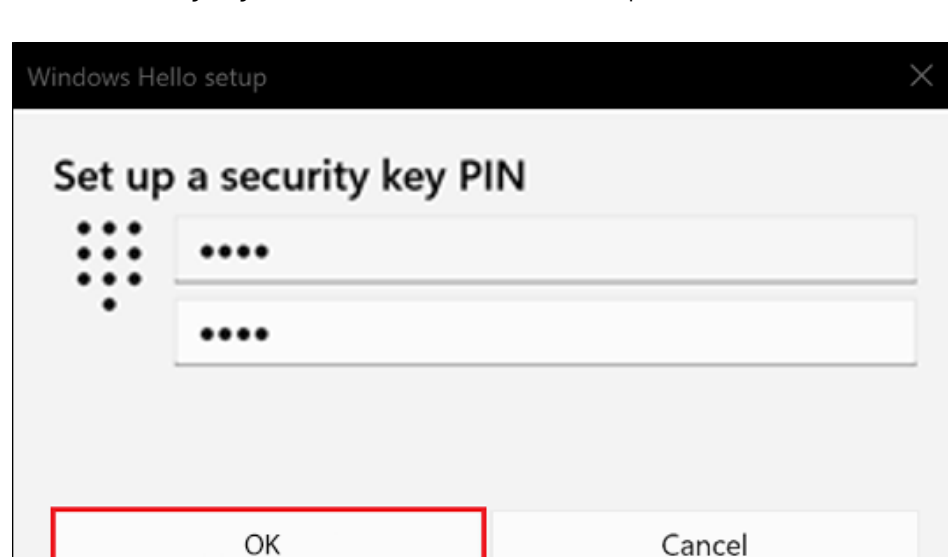


8. Once **PIN** has been set up enter it on the **Windows Hello setup**.

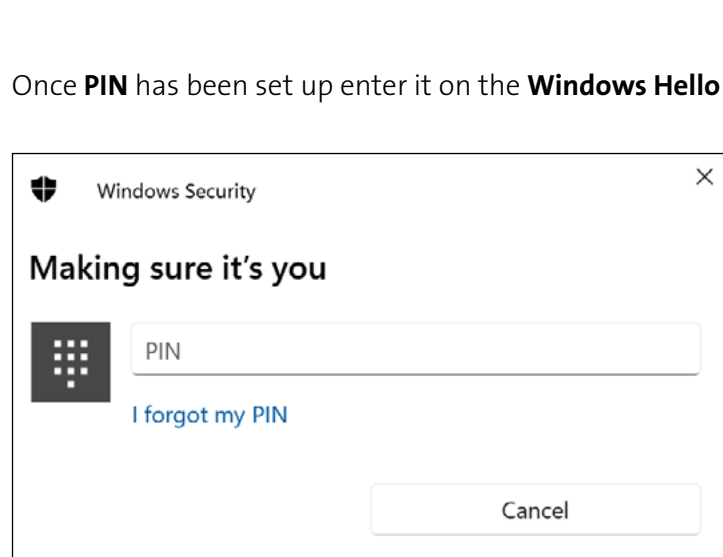


9. **Touch** the fingerprint sensor area repeatedly.

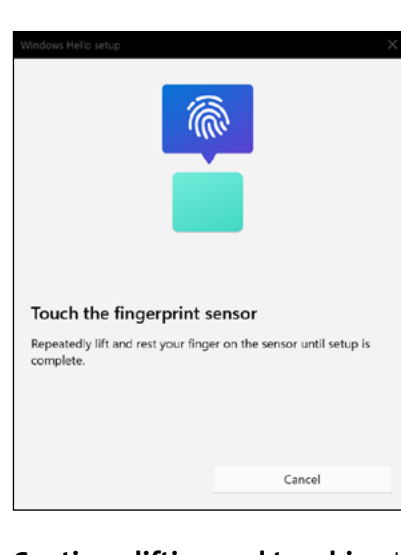

10. **Continue lifting and touching** the sensor to read fingerprint.

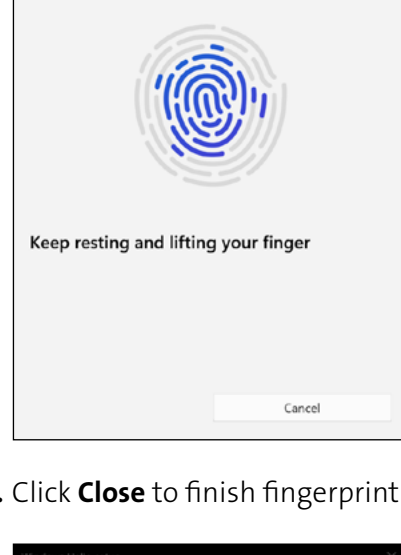

11. Click **Close** to finish fingerprint enrollment or **Add another finger** to set up another fingerprint.

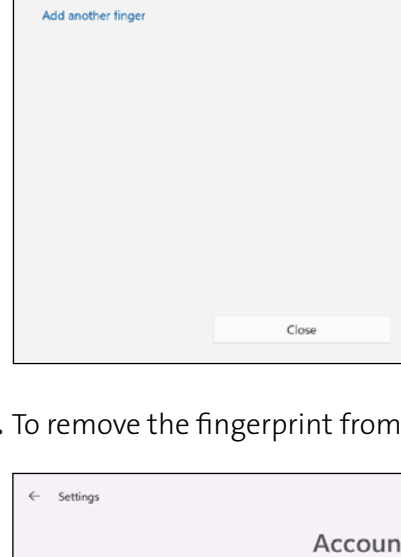

12. To remove the fingerprint from the USB dongle click on **remove**.

